

YOUR ONESURVEY HOME REPORT

ADDRESS

Primrose Hill
15 Ashgrove Terrace
Lockerbie
DG11 2BQ

PREPARED FOR

Dolina Copland

INSPECTION CARRIED OUT BY:



ALLIED
SURVEYORS
SCOTLAND

SELLING AGENT:

Braidwoods Solicitors

HOME REPORT GENERATED BY:

oneSURVEY | 
HOME REPORT

Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	Dumfries - Allied Surveyors Scotland Ltd	19/05/2026
Mortgage Certificate	Final	Dumfries - Allied Surveyors Scotland Ltd	19/05/2026
Property Questionnaire	Final	Mrs. Dolina Copland	04/06/2026
EPC	FileUploaded	Dumfries - Allied Surveyors Scotland Ltd	18/05/2026

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories
being rated from 1 to 3.



Single Survey

Survey report on:

Customer	Mrs. Dolina Copland
-----------------	---------------------

Selling address	Primrose Hill 15 Ashgrove Terrace Lockerbie DG11 2BQ
------------------------	---

Date of Inspection	18/05/2026
---------------------------	------------

Prepared by	Simon Allen, Bsc MRICS Dumfries - Allied Surveyors Scotland Ltd
--------------------	--

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The property consists of a detached, two-storey dwellinghouse.
Accommodation	Ground floor: Entrance vestibule, hallway, lounge, dining room, sitting room, kitchen, utility room and toilet. First floor: Landing, 4 bedrooms, dressing room and bathroom incorporating WC.
Gross internal floor area (m2)	Approximately 196 m ² .
Neighbourhood and location	The subjects are situated within an established residential development on the west side of Lockerbie, neighbouring properties comprising a mixture of residential styles. The property is reasonably convenient for the town centre and most local amenities. Motorway and mainline rail connections are available within a mile the property.
Age	The property is estimated to date from around 1890.
Weather	Generally overcast with sunny intervals.
Chimney stacks	Visually inspected with the aid of binoculars where required. The property possesses a single chimney stack, which is of dressed sandstone construction with lead flashings. A former chimney stack has been removed and replaced with an upright alloy flue, which serves the gas fire in the lounge. The central heating boiler connects to a balanced flue.

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where required. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The principal pitched and hip-ended roof is timber framed and clad with slates nailed to timber sarking boards. The presence of roofing felt between the slates and sarking could not be confirmed. Ridges are finished with clay tiles or zinc. Valley gutters appear to be lead lined. A restricted inspection of the roof void was available through a ceiling hatch in the bathroom, revealing the presence of mineral wool insulation above ceilings to an average depth of approximately 150mm. The lean-to roof above the utility room and toilet extension is pitched, timber framed and clad with slates. There is no accessible roof void. The roof projections above the front bay windows are partly flat and are covered with fibreglass.
Rainwater fittings	Visually inspected with the aid of binoculars where required. Rainwater conductors appear to be formed in PVC.
Main walls	Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected. The main walls of the original dwellinghouse are of solid, dressed sandstone construction, strapped and dry lined internally with lath and plaster. The walls enclosing the single-storey rear extension are cavity brick.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are of a UPVC framed casement design, incorporating sealed unit double glazing. External access doors fitted to the entrance vestibule and utility room are of a timber panelled design. UPVC framed and fully double glazed French doors are incorporated within the rear wall of the sitting room.
External decorations	Visually inspected. External joinery and the brick outer walls of the rear extension have been painted.
Conservatories / porches	None.


Communal areas	None.
Garages and permanent outbuildings	Visually inspected. The property includes two individual, single-car garages. One is of a concrete block construction, whilst the other consists of precast concrete panelled walls with a roughcast finish. Roofs are pitched, with corrugated cladding. Vehicular access doors are of an aluminium up and over style. The interiors of the garages have not been inspected. A timber framed greenhouse set on concrete block base walls adjoins one of the garages.
Outside areas and boundaries	Visually inspected. The property includes private garden ground, which surrounds the dwellinghouse and is generally laid to grass, with gravel, tarmac, concrete and paved footpaths/driveway. Property boundaries are defined by a sandstone roadside wall, a timber fence and privet hedging.
Ceilings	Visually inspected from floor level. Ceilings would appear to be lined with lath and plaster or plasterboard.
Internal walls	Visually inspected from floor level. Internal walls are either solid masonry with a plaster finish or consist of timber framed stud partitions lined with lath and plaster. The walls in the bathroom have been tiled.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch. Floors are predominantly of suspended timber construction. The floors in the entrance vestibule, utility room and toilet appear to be solid concrete. An inspection of floor surfaces was severely restricted due to the presence of securely fitted floor coverings. Subfloor areas could not be accessed.

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. Internal joinery generally consists of moulded timber skirting boards, facings, panelled doors and surrounds, most of which would appear to be original. The kitchen has been provided with a range of base and wall mounted cupboard units, with laminated doors and fitted worktops. There is an inset stainless steel sink unit. An additional base cupboard unit, fitted worktop and stainless steel sink have been installed in the utility room.
Chimney breasts and fireplaces	Visually inspected. No testing of the flues or fittings was carried out. A living flame gas fire has been installed in the lounge, set within a marble fireplace with timber surround. A marble fireplace has been retained in the dining room, presently occupied by an electric fire. Original fireplaces elsewhere in the property have been removed and the base of the flues vented.
Internal decorations	Visually inspected. Papered and/or painted finishes have been applied to most wall and ceiling surfaces. The walls in the bathroom have been tiled. Internal joinery has been painted.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on. Mains electricity is connected, serving 13 amp square pin sockets. The electricity meter and consumer unit are located in the ground floor toilet.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on. Mains gas is connected and the external meter box is attached to the left-hand wall of the dwellinghouse.

Water, plumbing and bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Mains water is connected and visible plumbing was generally seen to be copper. There is an insulated PVC cold water storage tank in the roof space. The bathroom has been provided with a coloured suite comprising WC, wash hand basin and standard sized bath. There is a separate shower enclosure, with white shower tray.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. Central heating is provided by a gas-fired Potterton Kingfisher boiler, which is situated in the kitchen and serves radiators throughout the property. The heating appear to be controlled by a central programmer, room thermostat and individual thermostatic valves fitted to radiators. Domestic hot water is provided by the central heating boiler, supplemented by an electric immersion system fitted to a factory insulated hot water storage cylinder, located in the dressing room wardrobe.
Drainage	Drainage covers etc were not lifted. Neither drains nor drainage systems were tested. Drainage is to the main sewer.

Fire, smoke and burglar alarms	Visually inspected. No test whatsoever were carried out to any systems or appliances. For security reasons, no comment is made regarding the presence of otherwise of burglar alarm systems. Smoke detectors have been installed in the entrance hall, lounge, dining room and upper landing, with a heat detector in the kitchen. There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required. The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022. We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.
Any additional limits to inspection	At the time of inspection, the property was unoccupied and unfurnished. Floor coverings were present throughout the property, severely restricting an inspection of floor surfaces. Subfloor areas could not be accessed. Windows and external doors were not all fully opened or tested. With properties of this type and age, various parts of the structure, such as joists and lintels, are in direct contact with the main external walls, but are hidden from view behind wall linings etc and cannot be seen or reported upon. Those areas which were not inspected cannot be reported as being free from defect, and any comments regarding the condition of the property must be read in this context. The report does not include an asbestos inspection. However, asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor. We do not carry out an inspection for Japanese Knotweed, which is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. We have assumed that there is no Japanese Knotweed within the boundaries of the property or in neighbouring properties. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists, removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.

Sectional Diagram showing elements of a typical house

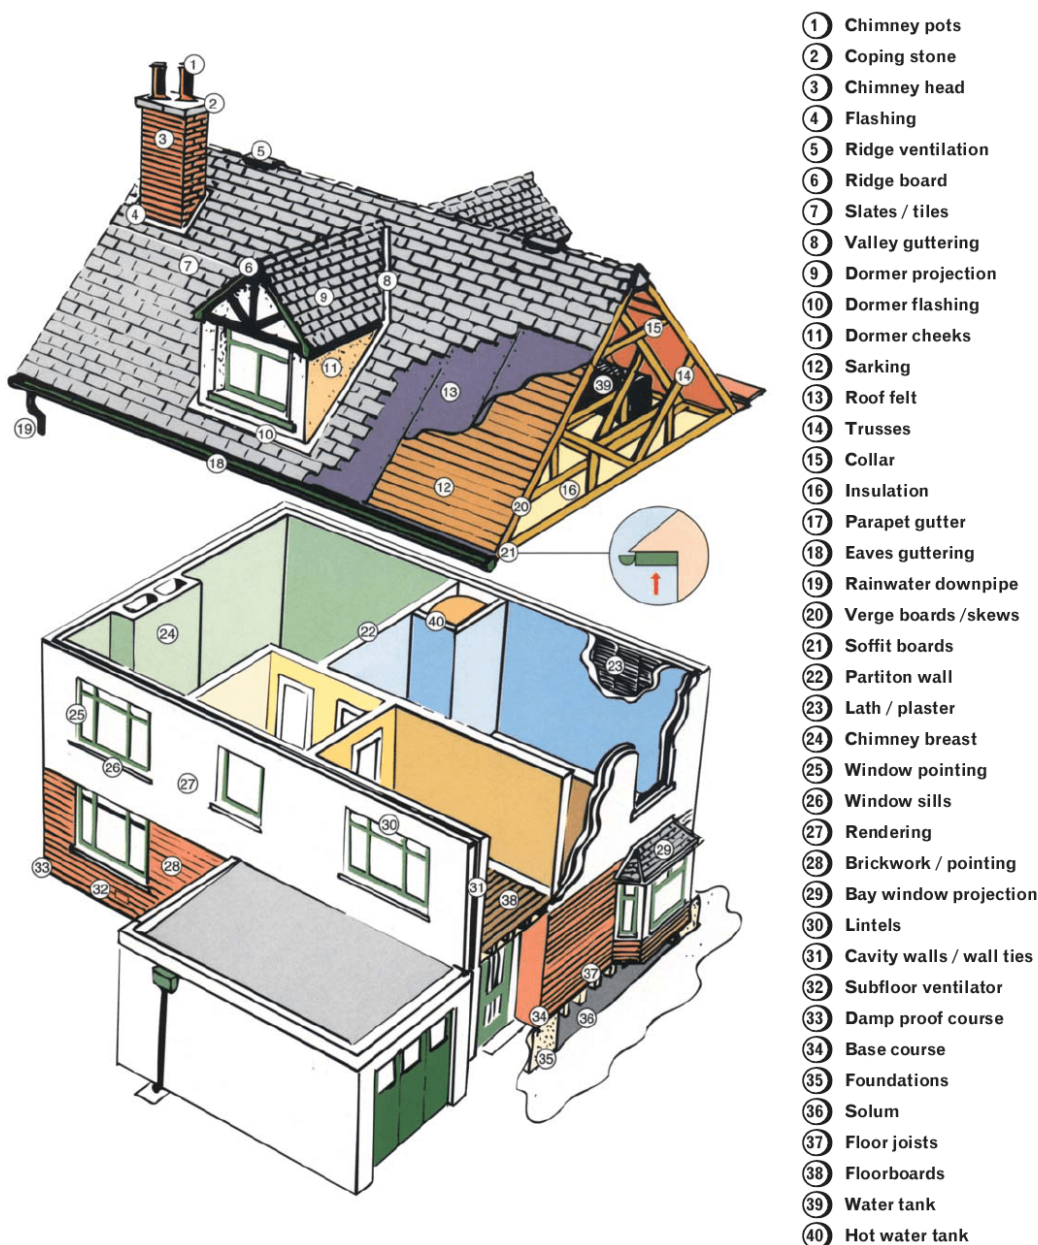

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	There is some evidence of past movement having affected the property, with minor settlement cracks in the outer wall of the rear extension and some unevenness within internal door openings. On the basis of a single inspection, this movement is considered to be historic and non-progressive in nature, with little likelihood of further significant movement in the future.

Dampness, rot and infestation	
Repair category:	3
Notes:	Patches of moisture were identified in some lower wall plaster, most notably in the rear right-hand corner of the lounge, at the base of the gable wall in the sitting room and within the utility room and toilet. Patches of moisture were identified in upper wall surfaces in some bedrooms, immediately beneath the remaining and former chimney stacks. Part of the ceiling in the kitchen has collapsed, most likely due to a plumbing leak in the bathroom above. It is assumed that this issue has been resolved, although the ceiling requires to be reinstated. Woodworm was identified in some accessible roof timbers. A timber and damp specialist contractor should be instructed to carry out a full inspection of the property and undertake any necessary remedial works and associated repairs. There is evidence to indicate that an injection damp proof course has been inserted into the walls of the original outer stone walls. The existence of any active warranty for this work should be confirmed.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Chimney stacks

Repair category:	2
Notes:	Whilst no significant defects were identified, the lead flashings could not be fully inspected from ground level. Patches of moisture were identified within internal wall surfaces beneath the chimney stack and further investigation is required. It should be ensured that disused flues are fully capped and ventilated.

Roofing including roof space

Repair category:	2
Notes:	As previously reported, woodworm was identified in some accessible roof timbers, requiring further specialist investigation. There are a number of loose and displaced roof slates requiring routine maintenance. The slate roof coverings may be original and ongoing maintenance should therefore be expected. Insulation within the accessible roof space falls short of current recommendations, which are for a minimum of 270 mm of mineral wool.

Rainwater fittings

Repair category:	2
Notes:	The rainwater downpipe at the right-hand gable is missing. The PVC rainwater gutter fitted to the rear extension is cracked and the connecting downpipe falls short of extending fully to the surface collection drain. Rainwater conductors should be regularly checked and cleaned out.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Main walls

Repair category:	2
Notes:	There are several small patches of eroded pointing, which require attention. Whilst no immediate action would appear to be necessary, there is some surface weathering to base stonework, most notably at the left-hand gable.

Windows, external doors and joinery

Repair category:	2
Notes:	There is some surface weathering to external timber doors, with patches of decay to the frames. Paintwork is weathered and flaking. Windows were not all fully opened or tested, and it should be appreciated that some defects are only evident during certain weather conditions. Within the limitations of the inspection, no significant defects were noted. Windows are of an age and style where a degree of ongoing maintenance should be anticipated to sealed units and opening mechanisms.

External decorations

Repair category:	2
Notes:	There is some weathered and flaking paintwork.

Conservatories / porches

Repair category:	
Notes:	Not applicable.

Communal areas

Repair category:	
Notes:	Not applicable.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Garages and permanent outbuildings

Repair category:	2
Notes:	The garages are dated and suffering from general weathering and deterioration. The roofs are defective or improved condition. The timber framed greenhouse is suffering from weathering and localised decay. A continuing programme of repair and maintenance should be anticipated in respect of outbuildings.

Outside areas and boundaries

Repair category:	1
Notes:	Whilst no serious issues were identified, continuing maintenance in respect of outside areas and boundaries should be anticipated. The iron railings and gates to the front of the property are affected by corrosion and a lack of recent decorative maintenance.

Ceilings

Repair category:	2
Notes:	Part of the ceiling in the kitchen has collapsed, most likely due to a plumbing leak in the bathroom above. The ceiling requires to be reinstated. Cracks were identified in some areas of ceiling plaster, generally commensurate with the age of the building. These may be disguised during future redecoration.

Internal walls

Repair category:	3
Notes:	As previously reported, patches of moisture were identified in some wall surfaces, requiring further specialist investigation. Surface imperfections were identified within some older areas of wall plaster, generally commensurate with age of the building.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Floors including sub-floors

Repair category:	2
Notes:	There are a number of loose and uneven floorboards requiring attention. Moisture in lower wall surfaces can represent a threat to subfloor timbers and moisture related issues need to be addressed without delay.

Internal joinery and kitchen fittings

Repair category:	2
Notes:	Kitchen fittings are dated and suffering from general wear and tear. Prospective purchasers are likely to consider upgrading of kitchen fittings to be desirable. Internal joinery is generally in fair condition relative to its age, normal wear and tear accepted.

Chimney breasts and fireplaces

Repair category:	1
Notes:	It is assumed that the gas fire in the lounge has been properly installed and maintained in accordance with all current regulations, with particular emphasis on flueing and ventilation requirements. A visual inspection revealed no obvious issues, although the fire was not lit at the time of inspection. The open fire in the dining room would not appear to have been in recent use. The fireplace and flue should be inspected and tested prior to any proposed future use.

Internal decorations

Repair category:	2
Notes:	Whilst decoration is largely a subjective matter, it is considered likely that most prospective purchasers would wish to undertake a programme of internal redecoration.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Cellars	
Repair category:	
Notes:	None.

Electricity	
Repair category:	2
Notes:	Whilst a visual inspection revealed no serious issues, some aspects of the electrical installation are dated and may not fully meet current electrical standards. It should be noted that relevant trade associations recommend that electrical installations be checked every five years or on change of ownership, in order to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations. There is no evidence of recent testing of the electrical system and a competent electrical contractor should therefore be instructed to test the installation.

Gas	
Repair category:	2
Notes:	In the interests of safety and in light of recent regulations it would be prudent to have all gas appliances checked by a Gas Safe registered contractor. Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Water, plumbing and bathroom fittings

Repair category:	2
Notes:	Part of the ceiling in the kitchen has collapsed, most likely due to a plumbing leak in the bathroom above. Plumbing installations should be checked by a qualified plumber as a precaution. Bathroom fittings are dated and prospective purchasers may consider upgrading to be desirable.

Heating and hot water

Repair category:	2
Notes:	It is assumed that the central heating and hot water systems have been properly installed and maintained in accordance with all current regulations, with particular emphasis on flueing and ventilation requirements. Failure to regularly test and service central heating boilers and associated fittings can increase safety risks and reduce efficiency. The most recent date of servicing should therefore be confirmed, prior to making a commitment to purchase. The central heating boiler is dated. Informed opinion suggests that boilers have a life expectancy of between 10 and 20 years, depending on the quality of the boiler and whether or not regular maintenance has been carried out. Future repair or replacement should be anticipated.

Drainage

Repair category:	1
Notes:	A surface inspection within the immediate vicinity of the property revealed no obvious issues.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories / porches	
Communal areas	
Garages and permanent outbuildings	2
Outside areas and boundaries	1
Ceilings	2
Internal walls	3
Floors including sub-floors	2
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	1
Internal decorations	2
Cellars	
Electricity	2
Gas	2
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground and first floors
2. Are there three steps or fewer to a main entrance door of the property?	☒ YES ☐ NO
3. Is there a lift to the main entrance door of the property?	☐ YES ☒ NO
4. Are all door openings greater than 750mm?	☐ YES ☒ NO
5. Is there a toilet on the same level as the living room and kitchen?	☐ YES ☒ NO
6. Is there a toilet on the same level as a bedroom?	☒ YES ☐ NO
7. Are all rooms on the same level with no internal steps or stairs?	☐ YES ☒ NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	☒ YES ☐ NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The assumed tenure is absolute ownership.

Roads and footpaths within the vicinity of the property have been made up and are believed to be maintained at public expense.

There would not appear to have been any recent physical amendments made to the property (within the past 20 years) for which local authority consent is likely to have been required.

There is evidence to suggest that an injection damp proof course has been incorporated within the original outer stone walls of the dwellinghouse. Any active warranty for this work should be transferred at the date of sale.

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the cost implications of these issues prior to making an offer to purchase.

Estimated re-instatement cost (£) for insurance purposes

£1,470,000

One Million Four Hundred and Seventy Thousand Pounds. This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.

Valuation (£) and market comments

£310,000

The market value of the property as described in this report is Three Hundred and Ten Thousand Pounds.

This figure assumes vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights.

Report author:	Simon Allen, Bsc MRICS
Company name:	Dumfries - Allied Surveyors Scotland Ltd
Address:	35 Buccleuch Street Dumfries DG1 2AB
Signed:	Electronically Signed: 314317-26356689-8508

Date of report:	19/05/2026
-----------------	------------

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.



Mortgage Valuation Report

Mortgage Valuation Report

Property:	Primrose Hill 15 Ashgrove Terrace Lockerbie DG11 2BQ	Client: Mrs. Dolina Copland Tenure: Absolute Ownership
Date of Inspection:	18/05/2026	Reference: DFS/26/410

This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

The subjects are situated within an established residential development on the west side of Lockerbie, neighbouring properties comprising a mixture of residential styles. The property is reasonably convenient for the town centre and most local amenities. Motorway and mainline rail connections are available within a mile the property.

2.0 DESCRIPTION 2.1 Age: Approximately 135 years

The property consists of a detached, two-storey dwellinghouse, with two individual garages and surrounding garden ground.

3.0 CONSTRUCTION

Roofs are pitched, timber framed and clad with slates.

The main walls of the original dwellinghouse are of solid, dressed sandstone construction. The walls enclosing the single-storey rear extension are cavity brick.

Floors are of suspended timber or solid concrete construction.

4.0 ACCOMMODATION

Ground floor: Entrance vestibule, hallway, lounge, dining room, sitting room, kitchen, utility room and toilet.

First floor: Landing, 4 bedrooms, dressing room and bathroom incorporating WC.

5.0 SERVICES (No tests have been applied to any of the services)

Water:	Mains	Electricity:	Mains	Gas:	Mains	Drainage:	Main sewer
Central Heating:	Oil fired boiler serving radiators.						

6.0 OUTBUILDINGS

Garage: Two detached, single-car garages.

Others: Greenhouse adjoining garage.

7.0	GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>
The property is currently in need of repair and maintenance in a number of respects which, in addition to essential repair work as itemised under section 8.0 below, typically includes the following:- 1. Whilst there is some evidence of movement having affected the property, this is not considered to be of ongoing structural concern. 2. Woodworm was identified in some accessible roof timbers. A timber specialist should be instructed to carry out a full inspection of the property and undertake any necessary remedial works. 3. Part of the ceiling in the kitchen has collapsed, most likely due to a plumbing leak in the bathroom above. It is assumed that this issue has been resolved, although the ceiling requires to be reinstated. 4. There are a number of loose and displaced roof slates requiring routine maintenance. The slate roof coverings may be original and ongoing maintenance should therefore be expected. 5. The rainwater downpipe at the right-hand gable is missing. The PVC rainwater gutter fitted to the rear extension is cracked and the connecting downpipe falls short of extending fully to the surface collection drain. 6. There are several small patches of eroded pointing, which require attention. 7. There is some surface weathering to external timber doors, with patches of decay to the frames. Paintwork is weathered and flaking. Windows are of an age and style where a degree of ongoing maintenance should be anticipated to sealed units and opening mechanisms. 8. There are a number of loose and uneven floorboards requiring attention. 9. There is no evidence of recent testing of the electrical system and a competent electrical contractor should therefore be instructed to test the installation. 10. The central heating boiler is dated. Informed opinion suggests that boilers have a life expectancy of between 10 and 20 years, depending on the quality of the boiler and whether or not regular maintenance has been carried out. Future repair or replacement should be anticipated. 11. Prospective purchasers are likely to consider a programme of internal upgrading and modernisation in respect of fixtures, fittings and decoration to be desirable. 12. Garages/outbuildings are in need of general maintenance and repair.	
8.0	ESSENTIAL REPAIR WORK <i>(as a condition of any mortgage or, to preserve the condition of the property)</i>
1. Patches of moisture were identified within some lower wall surfaces, and within upper plasterwork beneath the existing chimney stack and former chimney. A timber and damp specialist contractor should be instructed to carry out a full inspection of the property and undertake any necessary remedial works and associated repairs. * The recommended retention is for mortgage security purposes only and does not necessarily reflect the full cost of any required repairs. Specialist reports and estimates should be obtained, prior to making a commitment to purchase.	
8.1 Retention recommended:	
£5,000 *	
9.0	ROADS & FOOTPATHS
Made up and adopted.	

10.0	BUILDINGS INSURANCE (£):	1,470,000	GROSS EXTERNAL FLOOR AREA	244	Square metres
	<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>				
11.0	GENERAL REMARKS				
At the time of inspection, the property was unoccupied and unfurnished. Floor coverings were present throughout. Weather conditions were dry.					
There would not appear to have been any recent physical amendments made to the property (within the past 20 years) for which local authority consent is likely to have been required.					
There is evidence to suggest that an injection damp proof course has been incorporated within the original outer stone walls of the dwellinghouse. Any active warranty for this work should be transferred at the date of sale.					
Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the cost implications of these issues prior to making an offer to purchase.					
12.0	VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>				
12.1	Market Value in present condition (£):	£310,000	Three Hundred and Ten Thousand Pounds.		
12.2	Market Value on completion of essential works (£):	£315,000	Three Hundred and Fifteen Thousand Pounds		
12.3	Suitable security for normal mortgage purposes?	Yes			
12.4	Date of Valuation:	19/05/2026			
Signature:		Electronically Signed: 314317-26356689-8508			
Surveyor:	Simon Allen	Bsc MRICS			Date: 19/05/2026
Dumfries - Allied Surveyors Scotland Ltd					
Office:	35 Buccleuch Street Dumfries DG1 2AB		Tel: 01387 254 425 Fax: email: dumfries@alliedsurveyorsscotland.com		

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	Primrose Hill 15 Ashgrove Terrace Lockerbie DG11 2BQ
-------------------------	---

Customer	Mrs. Dolina Copland
-----------------	---------------------

Customer address	Primrose Hill 15 Ashgrove Terrace Lockerbie DG11 2BQ
-------------------------	---

Prepared by	Simon Allen, Bsc MRICS Dumfries - Allied Surveyors Scotland Ltd
--------------------	--

Energy Performance Certificate (EPC)

Scotland

Dwellings

PRIMROSEHILL, 15 ASHGROVE TERRACE, LOCKERBIE, DG11 2BQ

Dwelling type: Detached house
Date of assessment: 18 May 2026
Date of certificate: 18 May 2026
Total floor area: 196 m²
Primary Energy Indicator: 340 kWh/m²/year

Reference number: 0180-2588-9250-2596-3185
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas


You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£13,983	See your recommendations report for more information
Over 3 years you could save*	£5,082	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

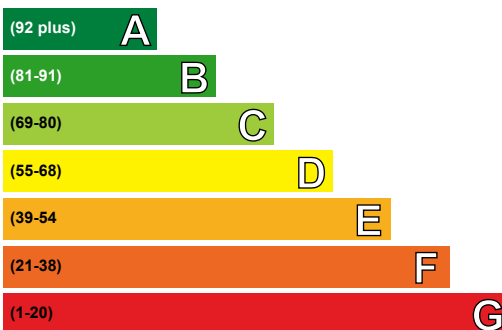

Not energy efficient - higher running costs

Current	Potential
47	68


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (47)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

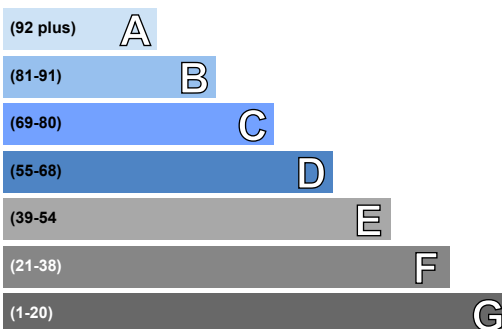

Not environmentally friendly - higher CO₂ emissions

Current	Potential
40	61

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (40)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal wall insulation	£7,500 - £11,000	£2802.00
2 Floor insulation (suspended floor)	£5,000 - £10,000	£873.00
3 Low energy lighting	£270 - £315	£126.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](https://www.greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction. See the addendum section on the last page of this report for further information relating to items in the table.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone, as built, no insulation (assumed)	★ ★ ☆ ☆ ☆	★ ★ ☆ ☆ ☆
Roof	Pitched, 150 mm loft insulation	★ ★ ★ ★ ☆	★ ★ ★ ★ ☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★ ★ ☆ ☆ ☆	★ ★ ☆ ☆ ☆
Main heating	Boiler and radiators, mains gas	★ ★ ★ ★ ☆	★ ★ ★ ★ ☆
Main heating controls	Programmer, room thermostat and TRVs	★ ★ ★ ★ ☆	★ ★ ★ ★ ☆
Secondary heating	Room heaters, mains gas	—	—
Hot water	From main system	★ ★ ★ ★ ☆	★ ★ ★ ★ ☆
Lighting	Below average lighting efficiency	★ ★ ☆ ☆ ☆	★ ★ ☆ ☆ ☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 62 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 12 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 4.7 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.



Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£12,372 over 3 years	£7,533 over 3 years	
Hot water	£1,182 over 3 years	£1,098 over 3 years	
Lighting	£429 over 3 years	£270 over 3 years	
Totals	£13,983	£8,901	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal wall insulation	£7,500 - £11,000	£934		
2 Floor insulation (suspended floor)	£5,000 - £10,000	£291		
3 Low energy lighting for all fixed outlets	£270 - £315	£42		
4 Replace boiler with new condensing boiler	£2,200 - £3,500	£288		
5 Replacement glazing units	£4,500 - £6,000	£140		
6 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£240		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Micro CHP

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

4 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

5 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

6 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	32,748.74	N/A	N/A	N/A
Water heating (kWh per year)	2,768.44			

Addendum

When considering the PV installation consider installing PV battery and a PV diverter for water heating

This dwelling has stone walls and may be exposed to wind driven rain and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Simon Allen
Assessor membership number:	EES/008215
Company name/trading name:	Allied Surveyors Scotland Ltd
Address:	35 Buccleuch Street Dumfries DG1 2AB
Phone number:	01387 254 424
Email address:	dumfries@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greenerscotland.org](https://www.greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address:

PRIMROSE HILL
15 ASHGROVE TERRACE
LOCKERBIE
DG11 2BQ

Seller/s:

MRS D. COPLAND

Completion date of Property Questionnaire:

30/5/26.

Property Questionnaire

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1	Length of ownership	
	How long have you owned the property?	Since Jan 2015 After my mother died
2	Council Tax	
	Which Council tax band is your property in?	D
3	Parking (tick all applicable)	
	☒ Garage ☒ Allocated Parking Space ☒ Driveway ☐ Shared Parking ☐ On Street ☐ Resident Permit ☐ Metered Parking ☐ Other (Please specify) 	
4	Conservation area	
	Is your property in a designated Conservation area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes
		No ☒
		Unknown

Property Questionnaire

5	Listed buildings		
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	Yes	
		No	✓
		Unknown	
6	Alterations/additions/extensions		
a (i)	During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet or bedroom)?	Yes	
	<u>If you have answered Yes</u> , please describe below the changes which you have made: 	No	✓
		Unknown	
(ii)	Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	Yes	
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	No	✓
		Unknown	
		N/A	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	Yes	
	<u>If you have answered Yes</u> , please answer the 3 questions below:	No	✓
		Unknown	
(i)	Were the replacements the same shape and type as the ones you replaced?	Yes	
		No	
		Unknown	
(ii)	Did this work involve any changes to the window or door openings?	Yes	
		No	
		Unknown	
(iii)	Please describe the changes made to the windows, doors, or patio doors (with approximate dates when the work was completed):		
	Please give any guarantees which you received for this work to your solicitor or estate agent.		

Property Questionnaire

7	Central heating		
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom/s, the hall and the bathroom) If you have answered Yes or Partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas, warm air). If you have answered Yes, please answer the 3 questions below:	Yes No Partial Unknown	✓
(i)	When was your central heating system or partial central heating system installed?		
(ii)	Do you have a maintenance contract for the central heating system? If yes, please give details of the company with which you have a maintenance contract:	Yes No Unknown	✓
(iii)	When was your maintenance agreement last renewed? (please provide the month and year)		
8	Energy Performance Certificate		
	Does your property have an Energy Performance Certificate which is less than 10 years old? (PLEASE NOTE: Please tick 'YES' as the surveyor will complete this at the time of inspection)	Yes	✓
9	Issues that may have affected your property		
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it? If you have answered Yes, is the damage the subject of any outstanding insurance claim?	Yes No Unknown Yes No	✓
b	Are you aware of the existence of asbestos in your property? If you have answered Yes, please give details:	Yes No Unknown	

Property Questionnaire

10	Services								
a	Please tick which services are connected to your property and give details of the supplier								
	Services	Connected	Supplier						
	Gas or liquid petroleum gas	✓	S Gas						
	Water mains or private water supply	✓	S Water						
	Electricity	✓	S Power						
	Mains drainage	✓	D.G.C						
	Telephone	✓	BT						
	Cable TV or satellite		N/A						
	Broadband		N/A						
b	Is there a septic tank system at your property?		<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="text-align: center;">Yes</td> <td style="text-align: center;">☐</td> </tr> <tr> <td style="text-align: center;">No</td> <td style="text-align: center;">☒</td> </tr> <tr> <td style="text-align: center;">Unknown</td> <td style="text-align: center;">☐</td> </tr> </table>	Yes	☐	No	☒	Unknown	☐
Yes	☐								
No	☒								
Unknown	☐								
	If you have answered Yes, please answer the 2 questions below:								
(i)	Do you have appropriate consents for the discharge from your septic tank?	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="text-align: center;">Yes</td> <td style="text-align: center;">☐</td> </tr> <tr> <td style="text-align: center;">No</td> <td style="text-align: center;">☐</td> </tr> <tr> <td style="text-align: center;">Unknown</td> <td style="text-align: center;">☐</td> </tr> </table>	Yes	☐	No	☐	Unknown	☐	
Yes	☐								
No	☐								
Unknown	☐								
(ii)	Do you have a maintenance contract for your septic tank?	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="text-align: center;">Yes</td> <td style="text-align: center;">☐</td> </tr> <tr> <td style="text-align: center;">No</td> <td style="text-align: center;">☐</td> </tr> </table>	Yes	☐	No	☐			
Yes	☐								
No	☐								
	If you have answered Yes, please give details of the company with which you have a maintenance contract: N/A								

Property Questionnaire

11	Responsibilities for shared or common areas									
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered Yes, please give details:	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr><td style="width: 80%;">Yes</td><td style="width: 20%; text-align: center;">☒</td></tr> <tr><td>No</td><td style="text-align: center;">☒</td></tr> <tr><td>Unknown</td><td style="text-align: center;">☐</td></tr> </table>	Yes	☒	No	☒	Unknown	☐		
Yes	☒									
No	☒									
Unknown	☐									
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr><td style="width: 80%;">Yes</td><td style="width: 20%; text-align: center;">☒</td></tr> <tr><td>No</td><td style="text-align: center;">☒</td></tr> <tr><td>Unknown</td><td style="text-align: center;">☐</td></tr> <tr><td>N/A</td><td style="text-align: center;">☐</td></tr> </table>	Yes	☒	No	☒	Unknown	☐	N/A	☐
Yes	☒									
No	☒									
Unknown	☐									
N/A	☐									
c	Has there been any major repair or replacement to any part of the roof during the time you have owned the property?	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr><td style="width: 80%;">Yes</td><td style="width: 20%; text-align: center;">☒</td></tr> <tr><td>No</td><td style="text-align: center;">☒</td></tr> <tr><td>Unknown</td><td style="text-align: center;">☐</td></tr> </table>	Yes	☒	No	☒	Unknown	☐		
Yes	☒									
No	☒									
Unknown	☐									
d	Do you have the right to walk over any of your neighbours' property – for example to put out your rubbish bin or maintain your boundaries? If you have answered Yes, please give details:	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr><td style="width: 80%;">Yes</td><td style="width: 20%; text-align: center;">☐</td></tr> <tr><td>No</td><td style="text-align: center;">☐</td></tr> <tr><td>Unknown</td><td style="text-align: center;">☐</td></tr> </table>	Yes	☐	No	☐	Unknown	☐		
Yes	☐									
No	☐									
Unknown	☐									
e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered Yes, please give details:	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr><td style="width: 80%;">Yes</td><td style="width: 20%; text-align: center;">☒</td></tr> <tr><td>No</td><td style="text-align: center;">☒</td></tr> <tr><td>Unknown</td><td style="text-align: center;">☐</td></tr> </table>	Yes	☒	No	☒	Unknown	☐		
Yes	☒									
No	☒									
Unknown	☐									
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered Yes, please give details:	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr><td style="width: 80%;">Yes</td><td style="width: 20%; text-align: center;">☒</td></tr> <tr><td>No</td><td style="text-align: center;">☒</td></tr> <tr><td>Unknown</td><td style="text-align: center;">☐</td></tr> </table>	Yes	☒	No	☒	Unknown	☐		
Yes	☒									
No	☒									
Unknown	☐									
12	Charges associated with your property									
a	Is there a factor or property manager for your property? If you have answered Yes, please provide the name and address, and give details of any deposit held and approximate charges:	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr><td style="width: 80%;">Yes</td><td style="width: 20%; text-align: center;">☒</td></tr> <tr><td>No</td><td style="text-align: center;">☒</td></tr> <tr><td>Unknown</td><td style="text-align: center;">☐</td></tr> </table>	Yes	☒	No	☒	Unknown	☐		
Yes	☒									
No	☒									
Unknown	☐									

Property Questionnaire

b	Is there a common buildings insurance policy? If you have answered Yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes No Unknown	☒ ☐ ☐
		Yes No Unknown	☐ ☒ ☐
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund. N/A		
13 Specialist works			
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered Yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	Yes No Unknown	☐ ☒ ☐
b	As far as you are aware, has any preventative work for dry rot, wet rot or damp ever been carried out to your property? If you have answered Yes, please give details:	Yes No Unknown	☐ ☒ ☐
c	If you have answered Yes to 13(a) or 13(b), do you have any guarantees relating to this work? If you have answered Yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	Yes No Unknown	☐ ☒ ☐

Property Questionnaire

14	Guarantees					
a	Are there any guarantees or warranties for any of the following?					
		No	Yes	Don't know	With title deeds	Lost
i)	Electrical Work	✓				
ii)	Roofing	✓				
iii)	Central Heating	✓				
iv)	National House Building Council (NHBC)	✓				
v)	Damp course	✓				
vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	✓				
b	If you have answered 'Yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s): N/A					
c	Are there any outstanding claims under any of the guarantees listed above? If you have answered Yes, please give details:				Yes	
					No	✓
					Unknown	
15	Boundaries					
	So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered Yes, please give details?				Yes	
					No	✓
					Unknown	

Property Questionnaire

16	Notices that affect your property		
In the past 3 years have you ever received notice:			
a	Advising that the owner of a neighbouring property has made a planning application?	Yes	
		No	✓
		Unknown	
b	That affects your property in some other way?	Yes	
		No	✓
		Unknown	
c	That requires you to do any maintenance, repairs or improvements to your property?	Yes	
		No	✓
		Unknown	
If you have answered Yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property. N/A			

Declaration by the seller(s) or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): _____

Date:

30/05/26

